

# MARION COUNTY SURVEYOR'S OFFICE



## SECTION CORNER RECORD

DEBRA S. JENKINS  
MARION COUNTY SURVEYOR

SEC. 22 TWN. 14<sub>N</sub> RNG. 5<sub>E</sub>

BRYAN F. CATLIN, PLS  
TECHNICAL SUPERVISOR

Date: 7-21-09  
Party Chief: Greene  
Crew: Taylor  
Type of Marker: Survey marker nail  
Method of Establishment: County: 1-6-1994  
IN S.P.C. E Zone, NAD 83  
Name: 14052207  
N: 487 398.818 7(m)  
E: 73 849.785 5(m)

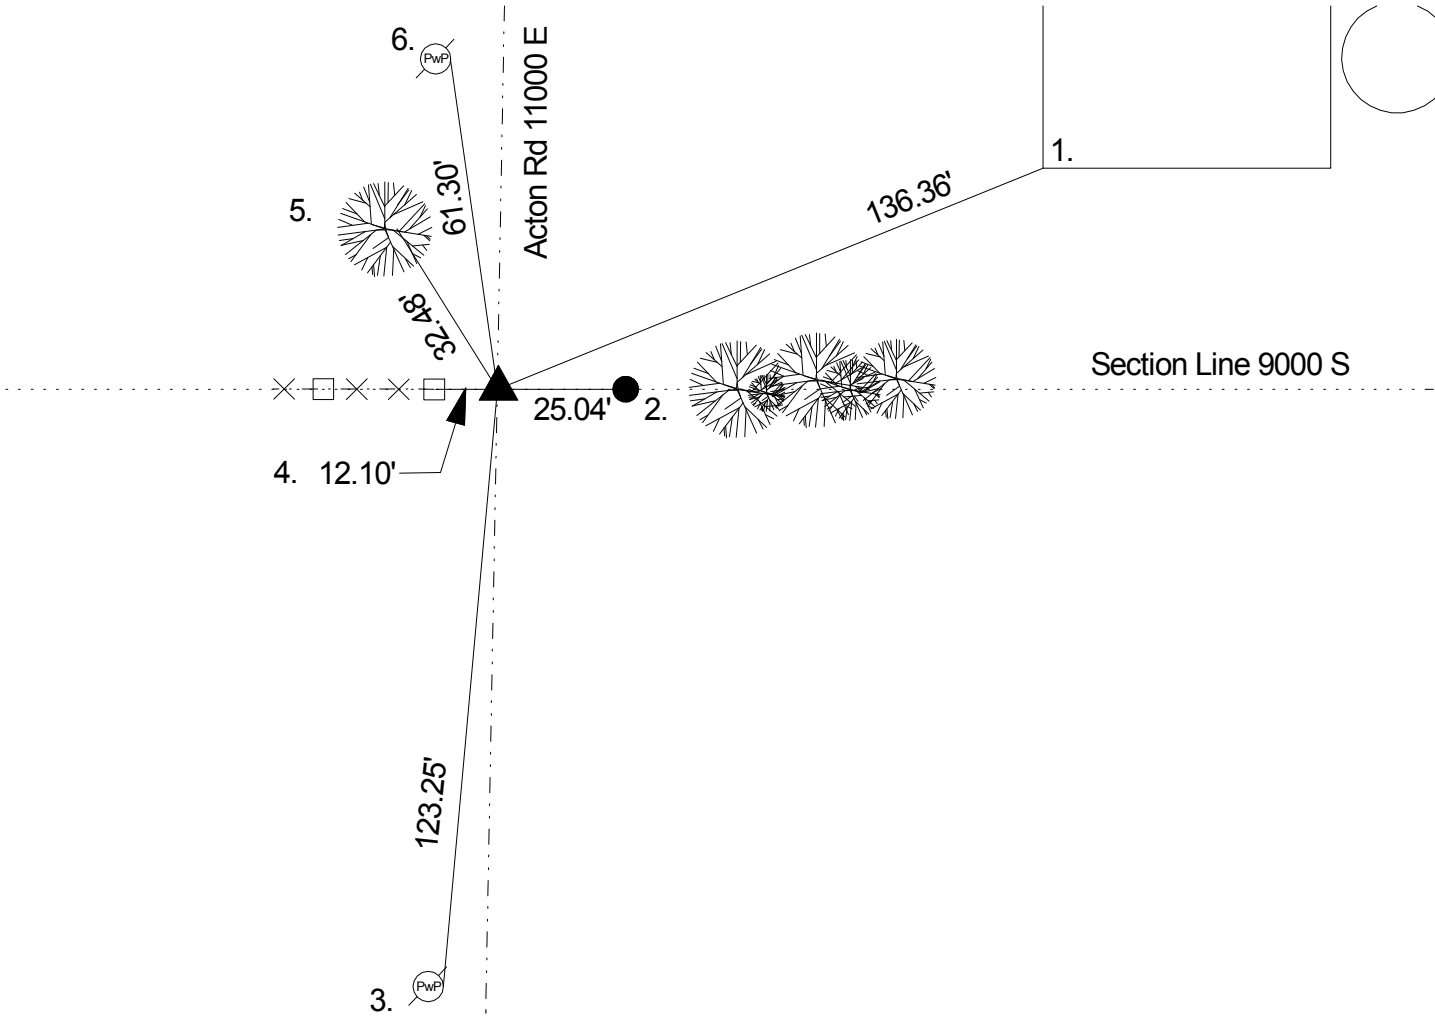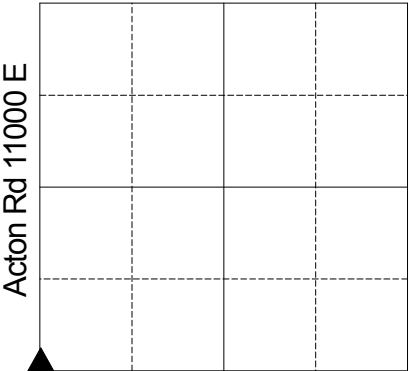

Corner originally set as a post in 1820 by John Hendricks with the following witnesses: 14" beech bearing N 29 E 34 links and a 12" sugar bearing S 16 E 14 links (Marion County Atlas p. 13). A survey by D.B.Hasbrook on December 18, 1850 indicates no stone but the following original witnesses were found plus these: 30" elm bearing S 51 W 35 links and a 12" beech bearing S 59 W 55 links (Franklin Legal Book p. 45). Corner was referenced by Monroe on 12/8/1959 and called a set stone 6" down and steel pin directly above it. Corner referenced by McLand on 1/3/68 and called a steel pin over stone 6" down. Corner referenced by SeFranka on 5/27/70 and called a steel pin over stone 6" down. Corner referenced by Marendt on 6/26/86 and called a R.R. spike found 4' west of centerline and stone 6" down. Corner referenced by Whiteside on 1/6/94 and called a R.R. spike 4' west of centerline and stone 6" down. Corner referenced by Kiste on 10/26/1998 and called a R.R. spike 4' west of centerline and stone 6" down. Corner referenced by Wilcoxen on 12/3/2002 and called a found survey marker nail. Corner referenced by Wilcoxen on 8/14/07 and called a survey marker nail. Corner referenced by Greene on 7/21/09 and called a survey marker nail.

REF.	DISTANCE	DESCRIPTION
1.	136.36'	SW corner of barn 4' up
2.	25.04'	SiteLine Capped Rebar
3.	123.25'	PK nail E PwP #55-831 D 1' up
4.	12.10'	Rd nail in washer N fence post 1' up
5.	32.48'	PK nail w/ Johnson County washer E 48" maple 14" up
6.	61.30'	PK nail E PwP #10-831 D 12" up